

Cooper Truck & Trailer, LLC.
 1377 130th St.
 Emerson, IA 51533
 Phone: 712-825-2607 Fax: 712-825-9182

INVOICE

247

Invoice from History

Printed Date: 02/21/2023

Work Completed: 06/30/2016

OPER TRUCK
 377 130th St
 Emerson, IA 51533
 Phone 999-999-9999

2006 Freightliner - Columbia -
 Lic # :
 Unit # : 2160
 VIN # : 1FUJA6CK4 6LU57959

Odometer In : 594305

Part Description / Number	Qty	Rate	Ext	Labor Description	Ext
Valve Cover Gasket TA0003	1.00	11.60	11.60	inspect engine	255.00
Oil Pan Gasket 2P X1/2 90D 90704	1.00	5.56	5.56	valve cover off, drain 25 gal off rain water out of oil pan. Pull #7 main and #6 rod caps inspect bearings. look good. everything covered in sludge.	
Oil Filter RS3518	1.00	63.56	63.56	intake tube has a good sized hole in it. suspect engine is dusted. Cam has a flat lobe and corresponding roller is bad.	
Oil Pan Gasket PA4857	1.00	17.24	17.24	looks to have new turbo, new egr valve, new water pump, new injectors, new xy shifter.	
Oil Filter 60291	1.00	4.94	4.94	missing ecm	
Oil Filter B495	2.00	15.87	31.74	LOT & DOT...fixes	212.50
Oil Pan Gasket R23538418	1.00	3,367.08	3,367.08	Done did that	
Oil Pan Gasket 23533692	1.00	377.41	377.41	overhaul	2,975.00
Oil Pan Gasket R23533694	1.00	1,226.20	1,226.20	remove cam, head and all wiring and accessories, remove power packs and clean all surfaces, including bores in block. R&I main bearings, and torque caps.	
Oil Pan Gasket R23524771	1.00	165.69	165.69	install pistons and rings, load powerpacks.	
Oil Pan Gasket 23532220	1.00	49.95	49.95	Jake/ install powerpacks, torque to spec, install oil pump& pick up tube, and oil pan. clean out rusted head bolt holes in block. install head, cam, injectors and rockers torq.	
Oil Pan Gasket 23539104	1.00	79.78	79.78	batterys	136.00
Oil Pan Gasket 23532325	1.00	82.23	82.23	replaced batterrys	
Oil Pan Gasket 23530682	2.00	2.52	5.04	right visor light inop	34.00
Oil Pan Gasket 31ECL	4.00	158.93	635.72	replace light assy	
Oil Pan Gasket 22-51942-000	1.00	39.27	39.27	check engine light	127.50
Oil Pan Gasket K4148	1.00	82.21	82.21	scan tested found vss code speed sensor had a bad terminal replaced sensor and found new module to be faulty switched out module and retested	
				detail cab	807.50
				clean out trash and unwanted items. remove back panel and replace with used one. sand and paint doors. dash and rest of cab. clean doors and jams. clean windows. scrub floor. tape off floor and paint.	
				remove visior	42.50
				remove visior and prep for paint	
				cut off dog ears	63.75
				cut dog ear off back of cab and prep for paint	
				buff cab	191.25
				buff cab	
				remove bumper	106.25
				remove bumper and prep for paint. sand bumper and paint	
				prep visior for primer and paint	106.25
				sand visior	