

Invoice

HD Diesel LLC
10502 Meadow DR
Two Rivers, Wi 54241

Date	Invoice #
1/22/2023	382

Bill To
Northeast Cattle 6400 Cty NN Denmark, Wi 54208

Ship To
Northeast Cattle 6400 Cty NN Denmark, WI 54208

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
	Due on receipt		1/22/2023			19 Chevy

Quantity	Item Code	Description	Price Each	Amount
1	84202	Oil Filter 6.6L	15.50	15.50
10	44819	15W40 Mobil Delvac	11.75	117.50
2	12643149	L5P Coolant Cross Over Gasket	11.67	23.34
1	97209341	6.6 Front Main Seal	57.10	57.10
1	94048159	Crankshaft Pin	3.56	3.56
2	dex	Dexcool antifreeze	19.80	39.60
1	shop	Shop supply	20.00	20.00
22.5	Labor	Bring truck into shop and diagnose why truck has low oil pressure when hot. Pick cab on truck and remove front cover to check oil pump. When pulling the harmonic Balancer off noticed that the Balancer was loose and not torqued to spec. Pull the front cover off truck and found that the harmonic Balancer is what presses the oil pump gear tight to the crank gear which spins the oil pump gear. When the motor was up to temp the oil pump gear was just spinning on the crank and not turning the oil pump. Remove oil pump and check gears inside. Pump looks like it should so put back together and put a keyway in crank so the oil pump gear will always spin no matter what. Put truck back together and torque Balancer bolt. Put cab back down and change oil and filter. Run truck outside and noticed you could smell coolant when hot. Found that the egr cooler has to be leaking into the passenger side exhaust manifold. Take truck on multiple test drives and found that the bottom end has a slight noise and pressure is low yet. Thinking there is a bad bearing in the bottom end. Clean up shop and fill out paper work.	110.00	2,475.00

Thank you for your business.

PD 1-23-23 #9362

Total

\$2,751.60

Maribel

BODY & PAINT

SANDBLASTING

Dave Malvitz
 13526 Marshak Rd.
 Maribel, WI 54227
 920-606-4046
 dave.malvitz@yahoo.com

Name Northeast Cattle Company Date 6-10-2022
 Address 14920 W Zander Rd Denmark 54203 Phone 9206551191

YEAR-COLOR		MAKE OF CAR	BODY TYPE	LICENSE NO.	V.I.N.	MILEAGE	
2019 Blue		Silverado	3500HD	W11863	1GCLYKXC44KF202529	217827	
REPAIR	REPLACE	DESCRIPTION OF LABOR OR MATERIAL			PARTS & MATERIALS	LABOR	REFINISHING
✓		R&I Hood				5	
✓		R&I Bumper and Grille				14	
	✓	R&R LH Headlamp Assy.			1115 37	3	
✓		R&I RH Headlamp Assy.				3	
	✓	R&R LH Fender			709 80	24	30
		Add for Clearcoat					12
	✓	R&R RH Fender			714 87	24	30
		Add for Clearcoat					12
✓		RH Front Door				35	24
		Add for Clearcoat					12
✓		LH Front Door				20	24
		Add for Clearcoat					12
	✓	R&R RH Door Mirror			824 09	4	
✓		Belt Mldg and glass both sides				24	
	✓	LH and RH 3500HD Emblem			145 30	6	
	✓	LH and RH Door Mldg			190 28	6	
	✓	LH and RH Front of Door Weather			299 10	6	
	✓	R&R RH Rear door			1014 44	50	34
		Add for Clearcoat					15
	✓	Door Mldg			99 90	3	

This estimate is based on our inspection and does not cover additional parts or labor which may be required after the work has been started. Worn or damaged parts which are not evident on first inspection may be discovered. Naturally this estimate cannot cover such contingencies. Parts prices subject to change without notice. This estimate is for immediate acceptance.

THIS WORK AUTHORIZED BY _____
 COMMENTS _____

NET PARTS COST \$ _____
 LABOR _____ HRS _____ \$ _____
 REFINISH _____ HRS _____ \$ _____
 PAINT & MATERIALS _____ \$ _____
 SUB TOTAL \$ _____
 TAX _____ % ON \$ _____ \$ _____
 LESS DEDUCTIBLE \$ _____ \$ _____
 NET TOTAL \$ _____

CUSTOMER #: 123903

1108889



INVOICE

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com

DUPLICATE 1
PAGE 1

2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

HOME: 920-655-1191 CONT: 920-655-1191
BUS: CELL: 920-655-1191

SERVICE ADVISOR: 1968 MARK BORTER

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 2019 Chevrolet Silverado.

Main parts list table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Lists various engine and filter parts with their respective costs.

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER...

"Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose..."

"Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis. Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

Summary table with columns: DESCRIPTION, TOTALS. Rows include LABOR AMOUNT, PARTS AMOUNT, GAS, OIL, LUBE, SUBLET AMOUNT, MISC. CHARGES, TOTAL CHARGES, INSURANCE / DISCOUNT, SALES TAX, and PLEASE PAY THIS AMOUNT.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

CUSTOMER #: 123903

1108889



INVOICE

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com

DUPLICATE 1
PAGE 2

2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

HOME: 920-655-1191 CONT: 920-655-1191
BUS: CELL: 920-655-1191

SERVICE ADVISOR: 1968 MARK BORTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GBA/Black	19	CHEVROLET SILVERADO	1GC4KXC4Y4KF202524	A029482	252646/252689	TT524	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31JUL19 DD			18:00 06OCT22		0.00	CASH	20OCT22
R.O. OPENED	READY	OPTIONS: SOLD-STK:A029482 ENG:6.6 LITER TURBO					

14:37 06OCT22	10:09 20OCT22
---------------	---------------

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
8	12664576	(S)	SEAL		8.07	8.07	64.56
1	19369733		ADHESIVE		11.16	11.16	11.16
2	11547206	(S)	PLUG		6.86	6.86	13.72
1	Z5001		FREIGHT OVN		100.00	99.00	99.00
10	88862497	15W40	MOBIL DELVAC 1300 CJ4		5.00	5.00	50.00
PARTS: 3479.53 LABOR: 2515.00 OTHER: 0.00					TOTAL LINE A:		5994.53
252646 SEE LINE B							

C LOW COOLANT LIGHT IS ON--ADVISE
60 ENGINE HEAVY - CUSTOMER STATES

2714 CTS

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

252646 CK OUT FOUND COOLING SYSTEM LOW. TOP OFF SYSTEM AND PRESSURE TEST OVERNIGHT, R & I COMPONENTS REMOVE TURBO UP PIPES, FOUND COOLANT IN BOTH PIPES, LOOK IN PIPES WITH CAMERA FOUND COOLANT COMING FROM CYL 3-5-6-7 EXH PORTS. REMOVED COMPONENTS AND CYLINDER HEADS, REMOVE VALVES FOUND MULTIPLE INTAKE AND EXH PORTS WASHED CLEAN AROUND VAVE GUIDES TO VALVES INDICATING ENGINE WAS OVERHEATED AND HEADS ARE CRACKED, REPLACED BOTH HEADS AND ALL RELATED COMPONENTS, REASSEMBLE, REFILL COOLING SYSTEM, ROAD TEST VEH MULTIPLE TIMES, RECHECK OPERATION OK. ON FINAL TEST DRIVE CHECK ENGINE CAME ON FOR A DETERIORATED CATALYTIC CONVERTER DUE TO THE AMOUNT OF COOLANT THAT WENT THROUGH THE EXHAUST SYSTEM. TECHNICIAN PERFORMED A REGENERATION OF THE SYSTEM AND TEST DROVE THE VEHICLE AND CHECK ENGINE LIGHT DID NOT RETURN. WE RECOMMEND DRIVING THE VEHICLE WITH A HEAVY LOAD FOR A LONG DISTANCE IN AN ATTEMPT TO BURN OFF AS MUCH COOLANT RESIDUE AS POSSIBLE IN THE CATALYTIC CONVERTER.

If for any reason you cannot answer your follow-up Survey COMPLETELY SATISFIED please contact our Service Representative at (920-496-3264). Thank you for your business.

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. A B- or W- PRECEDING THE DESCRIPTION OF A PART NUMBER DESIGNATES A LIMITED LIFETIME WARRANTY. PLEASE CONTACT YOUR SERVICE ADVISOR FOR FULL DETAILS OF COVERAGE.

"Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products."

Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911.

DESCRIPTION	TOTALS
LABOR AMOUNT	2515.00
PARTS AMOUNT	3479.53
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	5994.53
INSURANCE / DISCOUNT	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	5994.53

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DD 8512

CUSTOMER #: 123903

1104841

Broadway AUTOMOTIVE

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com
HOME:920-655-1191 CONT:371-6560
BUS: CELL:920-655-1191

INVOICE

DUPLICATE 2
PAGE 1


2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

SERVICE ADVISOR: 1968 MARK BORTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GBA/Black	19	CHEVROLET SILVERADO	1GC4KXC4Y4KF202524	A029482	244022/244022	TT524	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31JUL19 DD			18:00 14SEP22		0.00	CASH	14SEP22
R.O. OPENED	READY	OPTIONS: SOLD-STK:A029482 ENG:6.6 LITER_TURBO					
15:45 06SEP22	09:19 14SEP22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A SERVICE ENGINE SOON LIGHT IS ON AND REDUCED POWER --USED 3 GALLONS OF COOLANT SINCE PICKING UP							
70 DRIVE ABILITY - CUSTOMER STATES							
				2714		CTS	
1	12662184		GASKET		6.50	6.50	6.50
1	12687231	(S)	PIPE		50.93	50.93	50.93
1	12705429	(S)	PIPE		66.91	66.91	66.91
08	12698552	(S)	INJECTOR		299.61	299.61	2396.88
1	12686808	(S)	RAIL		309.64	309.64	309.64
01	12686810	(S)	RAIL		341.16	341.16	341.16
04	12720156	(S)	PIPE		44.12	44.12	176.48
1	12687230	F-(S)	PIPE		45.45	45.45	45.45
1	12718742	(S)	SENSOR		320.99	320.99	320.99
2	12680216	(S)	GASKET		6.07	6.07	12.14
2	12643149	(S)	GASKET		5.97	5.97	11.94
01	12677819	(S)	GASKET		26.80	26.80	26.80
01	12688018	(S)	GASKET		38.08	38.08	38.08
01	12688019	(S)	GASKET		38.46	38.46	38.46
02	12691860	(S)	GASKET		27.15	27.15	54.30
1	12676858	(S)	GASKET		100.81	100.81	100.81
3	12720157	(S)	PIPE		45.45	45.45	136.35
1	12688020		PIPE		170.02	170.02	170.02
1	12687474		HARNASS		392.06	392.06	392.06
36	11548837	(S)	BOLT		6.27	6.27	225.72
1	12676859	(S)	GASKET		105.69	105.69	105.69
1	12688018		GASKET		38.08	38.08	38.08
1	12673449	(S)	BODY		240.30	240.30	240.30
1	12665248	(S)	GASKET		5.79	5.79	5.79

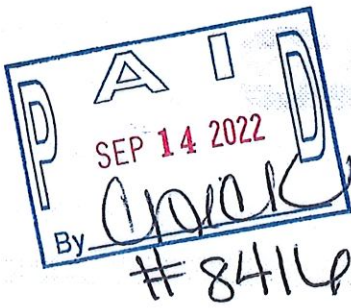

PARTS: 5311.48 LABOR: 7214.68 OTHER: 0.00 TOTAL LINE A: 12526.16

244022 CK OUT FOUND MULTIPLE DTCS STORED AND COOLANT LEVEL LOW.
REFILL COOLING SYSTEM, REMOVE EGR COOLER PIPE AND PRESSURE TEST COOLING SYSTEM FOUND NO EVIDENCE OF EGR COOLER LEAKING INDICATING HEAD GASKET FAILURE, FOUND MULTIPLE FUEL SYSTEM DTCS STORED INDICATING FUEL INJECTOR FAILURE FROM PREVIOUS INJECTION PUMP FAILURE, GAVE EST. R & I

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. A B- or W- PRECEDING THE DESCRIPTION OF A PART NUMBER DESIGNATES A LIMITED LIFETIME WARRANTY. PLEASE CONTACT YOUR SERVICE ADVISOR FOR FULL DETAILS OF COVERAGE.

"Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products."

"Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
INSURANCE / DISCOUNT	
SALES TAX	
PLEASE PAY THIS AMOUNT	

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

CUSTOMER #: 123903

1104841



2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

INVOICE

DUPLICATE 2
PAGE 2

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com
HOME:920-655-1191 CONT:371-6560
BUS: CELL:920-655-1191

SERVICE ADVISOR: 1968 MARK BORTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GBA/Black	19	CHEVROLET SILVERADO	1GC4KXC4Y4KF202524	A029482	244022/244022	TT524	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31JUL19 DD			18:00 14SEP22		0.00	CASH	14SEP22
R.O. OPENED	READY	OPTIONS: SOLD-STK:A029482 ENG:6.6 LITER TURBO					
15:45 06SEP22	09:19 14SEP22						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

COMPONENTS REPLACED HEAD GASKETS AND ALL RELATED SEALS, REPLACED FUEL INJECTORS, RAILS AND FEED LINES. FOUND ALL INJECTOR CONNECTORS SHOWING SIGNS OF FRACTURING, REPLACED INJECTOR/GLOW PLUG WIRE HARNESS, FOUND LEFT TURBO UP PIPE CRACKED REPLACED PIPE. REPLACED NOX SENSOR 1 DUE TO COOLANT CONTAMINATION, REASSEMBLE, PROGRAM INJECTOR FLOW RATES, REFILL ALL FLUIDS, CHANGE ENGINE OIL AND FILTER, PERFORM DPF SERVICE REGEN AND REDUCTANT SYSTEM MALFUNCTION TAMPER TEST FOUND TEST FAILED AND DTCS NOW SETTING FOR THROTTLE BODY. REPLACED THROTTLE BODY ASSEMBLY, PERFORM SECOND DPF SERVICE REGEN TO PURGE COOLANT FROM EXH SYSTEM, PERFORM SECOND REDUCTANT SYSTEM TAMPER TEST, FOUND TEST NOW PASSING, ROAD TEST VEH AND RECHECK OPERATION OK

B** LOF-DIESEL

CAUSE: SERVICE PERFORMED

13 LOF-DIESEL

2714 CTS

10 88862497 15W40 MOBIL DELVAC 1300 CJ4	5.00	36.50	36.50
---	------	-------	-------

1 12684038 (S) FILTER	13.91	9.95	9.95
-----------------------	-------	------	------

PARTS: 59.95	LABOR: 36.50	OTHER: 0.00	TOTAL LINE B: 96.45
--------------	--------------	-------------	---------------------

If for any reason you cannot answer your follow-up Survey COMPLETELY SATISFIED please contact our Service Representative at (920-496-3264). Thank you for your business.

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. A B- or W- PRECEDING THE DESCRIPTION OF A PART NUMBER DESIGNATES A LIMITED LIFETIME WARRANTY. PLEASE CONTACT YOUR SERVICE ADVISOR FOR FULL DETAILS OF COVERAGE.

"Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products."

"Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

DESCRIPTION	TOTALS
LABOR AMOUNT	7251.18
PARTS AMOUNT	5371.43
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	12622.61
INSURANCE / DISCOUNT	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	12622.61

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

CUSTOMER #: 123903

1102910

Broadway AUTOMOTIVE

2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

INVOICE

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com

PAGE 1

HOME: 920-655-1191 CONT: 371-6560

BUS: CELL: 920-655-1191 SERVICE ADVISOR: 1968 MARK BORTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GBA/Black	19	CHEVROLET SILVERADO	1GC4KXCY4KF202524	A029482	242698/242698	TT524	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31JUL19 DE			18:00 25AUG22		0.00	CASH	25AUG22
R.O. OPENED	READY	OPTIONS: SOLD-STK:A029482 ENG:6.6 LITER_TURBO					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A HORN, FOG LIGHTS , HIGH BEAMS ARE ALL INOP--ADVISE
 125 ELECTRICAL MINOR - CUSTOMER STATES
 2714 CTS 245.96 245.96
 1 84303174 (S)BLOCK 309.56 309.56 309.56
PARTS: 309.56 LABOR: 245.96 OTHER: 0.00 TOTAL LINE A: 555.52

242698 PERFORM DIAGNOSTICS FOUND UBEC BAD GAVE EST REPLACED UBEC
 FOUND ALL LIGHTS WORKING BUT HORN IS INOP, PERFORM DIAGNOSTICS FOUND
 HORN BAD GAVE EST CUST DECLINED FURTHER REPAIRS

B ENGINE IS USING COOLANT HEAVY--CHECK AND ADVISE
 60 ENGINE HEAVY - CUSTOMER STATES
 2714 CTS 0.00 0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

242698 CK OUT FOUND COOLANT LOW, FOUND TANK RECENTLY REPLACED, ROAD
 TEST VEH 50 MILES FOUND COOLANT LEVEL STAYED THE SAME, POSSIBLE AIR
 BUBBLE IN SYSTEM AFTER COOLANT TANK REPLACEMENT

C MULTI POINT INSPECTION
 CAUSE: SERVICE
 199 MULTI POINT INSPECTION
 2714 IMPI (N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

D** SERVICE ENGINE SOON LIGHT IS ON--CHECK AND ADVISE
 70 DRIVE ABILITY - CUSTOMER STATES
 2714 CTS 1967.64 1967.64
 3 12346290 COOLANT 30.69 30.69 92.07
 1 12658352 (S)SEAL 5.81 5.81 5.81
 2 12648141 (S)GASKET 5.66 5.66 11.32
 3 12680216 (S)GASKET 6.07 6.07 18.21
 2 12642410 (S)SEAL 7.20 7.20 14.40
 1 12705429 (S)PIPE 66.91 66.91 66.91
 1 12648140 (S)SEAL 11.68 11.68 11.68

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. A B- or W- PRECEDING THE DESCRIPTION OF A PART NUMBER DESIGNATES A LIMITED LIFETIME WARRANTY. PLEASE CONTACT YOUR SERVICE ADVISOR FOR FULL DETAILS OF COVERAGE.	*Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.	DESCRIPTION	TOTALS
	*Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911.	LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		INSURANCE / DISCOUNT	
		SALES TAX	
	(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)	CUSTOMER SIGNATURE	PLEASE PAY THIS AMOUNT

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

CUSTOMER #: 123903

1102910

Broadway AUTOMOTIVE

2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com

INVOICE

PAGE 2

HOME: 920-655-1191 CONT: 371-6560

BUS: CELL: 920-655-1191 SERVICE ADVISOR: 1968 MARK BORTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GBA/Black	19	CHEVROLET SILVERADO	1GC4KXCY4KF202524	A029482	242698/242698	TT524	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31JUL19 DD			18:00 25AUG22		0.00	CASH	25AUG22
R.O. OPENED	READY	OPTIONS:					
10:13 23AUG22	10:39 25AUG22	SOLD-STK:A029482 ENG:6.6_LITER_TURBO					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
2	12643149	(S)	GASKET		5.97	5.97	11.94
1	12643771	(S)	GASKET		5.87	5.87	5.87
1	12687231	(S)	PIPE		50.93	50.93	50.93
1	12701094	(S)	PUMP		1098.25	1098.25	1098.25
PARTS: 1387.39 LABOR: 1967.64 OTHER: 0.00					TOTAL LINE D:		3355.03

242698 CK OUT FOUND FUEL INJECTION PUMP NOISY, GAVE EST R & I
COMPONENTS REPLACED INJECTION PUMP AND RELATED COMPONENTS REASSEMBLE
REFILL AND BLEED COOLING SYSTEM RECHECK OPERATION OK

E** FUEL FILTER DIESEL

CAUSE: SERVICE

193 FUEL FILTER DIESEL

2714 CTS


1 13539108 (S) FILTER KIT

PARTS: 65.83 LABOR: 70.00 OTHER: 0.00 TOTAL LINE E: 135.83

SHOP SUPPLIES

39.93

CHEVROLET

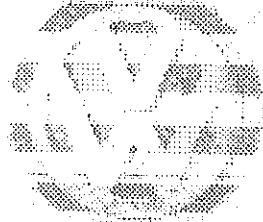

If for any reason you cannot answer your follow-up Survey COMPLETELY SATISFIED please contact our Service Representative at (920-496-3264). Thank you for your business.

THANK YOU!

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. A B- or W- PRECEDING THE DESCRIPTION OF A PART NUMBER DESIGNATES A LIMITED LIFETIME WARRANTY. PLEASE CONTACT YOUR SERVICE ADVISOR FOR FULL DETAILS OF COVERAGE.

"Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products."

Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911.

DESCRIPTION	TOTALS
LABOR AMOUNT	2283.60
PARTS AMOUNT	1762.78
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	39.93
TOTAL CHARGES	4086.31
INSURANCE / DISCOUNT	0.00
SALES TAX	224.75
PLEASE PAY THIS AMOUNT	4311.06

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

CUSTOMER #: 123903

1106595

Broadway AUTOMOTIVE

2700 S. Ashland Ave., P.O. Box 28437
Green Bay, WI 54324-0437
(920) 498-6666
www.BroadwayAutomotive.com

RICHARD J CRAANEN
14920 W ZANDER RD
DENMARK, WI 54208-9008
Clivestockllc@gmail.com
HOME:920-655-1191 CONT:920-655-1191
BUS: CELL:920-655-1191

INVOICE

PAGE 1

SERVICE ADVISOR: 1968 MARK BORTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
GBA/Black	19	CHEVROLET SILVERADO	1GC4KXCY4KF202524	A029482	246287/246287	TT524	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31JUL19 DD			18:00 20SEP22		0.00	CASH	21SEP22
R.O. OPENED	READY	OPTIONS: SOLD-STK:A029482 ENG:6.6 LITER TURBO					
07:38 20SEP22	10:40 21SEP22						

LINE OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
-------------	------	------	-------	------	-----	-------

A ENGINE IS USING COOLANT HEAVY--CHECK AND ADVISE
60 ENGINE HEAVY - CUSTOMER STATES

2714 CTS

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00 0.00
246287 0.00 CK OUT FOUND COOLANT LEAK FROM EGR COOLER BLEED PIPE

CLAMP, REPLACED CLAMP, REFILL AND BLEED SYSTEM ROAD TEST VEH AND RECHECK FOR LEAKS OK

B** SERVICE ENGINE SOON LIGHT IS ON--ADVISE

70 DRIVE ABILITY - CUSTOMER STATES

2714 CTS

1 12683525 (S) SENSOR 327.94 70.33 70.33 70.33 398.27

PARTS: 70.33 LABOR: 327.94 OTHER: 0.00 TOTAL LINE B: 70.33 70.33 70.33 398.27

246287 2.00 CK OUT FOUND MULTIPLE DTCS STORED PERFORM DIAGNOSTICS
FOUND EGT 5 READING ERRATICALLY AT TIMES FROM COOLANT CONTAMINATION,
FOUND SENSOR STUCK IN EXH, HEAT REMOVE AND RE TAP HOLE, REPLACED EGT
SENSOR 5 CLEAR DTC AND ROAD TEST VEH OK

If for any reason you cannot answer your follow-up Survey COMPLETELY SATISFIED please contact our Service Representative at (920-496-3264). Thank you for your business.

pd #8386

THANK YOU!

ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMED AT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. A B- or W- PRECEDING THE DESCRIPTION OF A PART NUMBER DESIGNATES A LIMITED LIFETIME WARRANTY. PLEASE CONTACT YOUR SERVICE ADVISOR FOR FULL DETAILS OF COVERAGE.

"Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products."

"Motor vehicle repair trade practices are regulated by chapter ATCP 132, Wis Adm. Code, administered by the Bureau of Consumer Protection, Wisconsin Dept. of Agriculture, Trade and Consumer Protection, P.O. Box 8911, Madison, Wisconsin 53708-8911."

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE)

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	327.94
PARTS AMOUNT	70.33
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	398.27
INSURANCE / DISCOUNT	0.00
SALES TAX	21.91
PLEASE PAY THIS AMOUNT	420.18

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

Invoice

HD Diesel LLC
10502 Meadow DR
Two Rivers, Wi 54241

Date	Invoice #
1/22/2023	382

Bill To
Northeast Cattle 6400 Cty NN Denmark, Wi 54208

Ship To
Northeast Cattle 6400 Cty NN Denmark, WI 54208

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
	Due on receipt		1/22/2023			19 Chevy

Quantity	Item Code	Description	Price Each	Amount
1	84202	Oil Filter 6.6L	15.50	15.50
10	44819	15W40 Mobil Delvac	11.75	117.50
2	12643149	LSP Coolant Cross Over Gasket	11.67	23.34
1	97209341	6.6 Front Main Seal	57.10	57.10
1	94048159	Crankshaft Pin	3.56	3.56
2	dex	Dexcool antifreeze	19.80	39.60
1	shop	Shop supply	20.00	20.00
22.5	Labor	Bring truck into shop and diagnose why truck has low oil pressure when hot. Pick cab on truck and remove front cover to check oil pump. When pulling the harmonic Balancer off noticed that the Balancer was loose and not torqued to spec. Pull the front cover off truck and found that the harmonic Balancer is what presses the oil pump gear tight to the crank gear which spins the oil pump gear. When the motor was up to temp the oil pump gear was just spinning on the crank and not turning the oil pump. Remove oil pump and check gears inside. Pump looks like it should so put back together and put a keyway in crank so the oil pump gear will always spin no matter what. Put truck back together and torque Balancer bolt. Put cab back down and change oil and filter. Run truck outside and noticed you could smell coolant when hot. Found that the egr cooler has to be leaking into the passenger side exhaust manifold. Take truck on multiple test drives and found that the bottom end has a slight noise and pressure is low yet. Thinking there is a bad bearing in the bottom end. Clean up shop and fill out paper work.	110.00	2,475.00

Thank you for your business.

DD 1-23-23 #93162

Total

\$2,751.60