Vehicle Information for 3ALXFB007LDLY2505 [Import into Excede]

Make Model Year **Model Number Series Code**

FTL CC132064 T

Base Model Number Config Code Body Style Gross Weight NO BODY

CORONADO G SPECIFIED

Interior Color Exterior Color 5th Wheel Type 5th Wheel Description

CAB COLOR A: L6734EY VIPER BLUE PEARL ELITE OPAL GRAY Н

Exhaust Suspension **Exhaust Type** Suspension Type Description Description

HORIZ AIR

Horsepower **In-Service Date Select Date** Sleeper Box Length

600 08/27/2020

Engine

Model Number **Serial Number Brake Type Code Brake Type Description**

6067BK60 06RE158803

Transmission

Mfr Code **Mfr Name Model Number** Serial number Fuel Capacity **Fuel Tanks**

300 2

Front Axle

Mfr Code Mfr Name **Model Number** Serial number Wheel Type Wheel Description

F120-3N 739912B0169635 **ALUMINUM**

Rear Axle

Mfr Code Mfr Name **Model Number** Serial number Ratio Wheel Type Wheel Description

REM ART40.0-4 771DDR-M007317T 3.42 A **ALUMINUM**

Front of Rear Axle

Mfr Code Mfr Name **Model Number** Serial number **REM ART40.0-4** 771DDR-M007317H

Color(s)

Exterior Paint Bumper Chassis **Exterior Sunvisor** Package

BLACK, HIGH SOLIDS PAINT: ONE SOLID SUNVISOR PAINTED SAME NO BUMPER PAINT

POLYURETHANE CHASSIS PAINT COLOR AS CAB COLOR A

Front Wheel Rear Wheel Cab Color B Cab Color C

PAINT-FRT WHEEL COLOR: PAINT-RR WHEEL COLOR: NONE CAB COLOR B: NONE CAB COLOR C: NONE NONE

Cab Color D Cab Color E Cab Color F **Cab Interior**

CAB COLOR D: NONE **CAB COLOR E: NONE CAB COLOR F: NONE**

Cab Paint Scheme **Chassis Side Faring** Chassis Paint Scheme Exterior Trim Comp Color

PAINT CAB ONE SOLID NO CHASSIS SIDE FAIRING COLOR **PAINT**

Fuel Tank Grille **Lift Gate Paint** Mirror NO FUEL TANK PAINT

NO MIRROR PAINT COLOR

Mixer Drum Color A **Mixer Drum Color B** Mixer Drum Color C **Mixer Drum Paint Scheme**

Number Of Colors Optional Color Pricing Pusher Tag Wheel Roof Aero Device NUMBER OF ELITE EY PAINT COLORS (1) Running Board RUNNING BOARDS PAINTED SAME AS FENDERS Wheel Aux Axle 2 OPTIONAL COLOR(S) PRICE - NONE Spare Wheel Rim

NO SPARE WHEEL PAINT

NO PUSHER/TAG WHEEL PAINT Truck Body Paint NO AERODYNAMIC ROOF DEVICE PAINT Wheel Aux Axle 1

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 (515) 957-3300 PHONE:

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012073153:01

09/11/2020

INVOICE DATE: INVOICE TERMS:

NET30

VEHICLE#: ORIG. DOCUMENT: E012011737

684935



SERVICE INVOICE

BILL-TO

DOUGLAS VERBRUGGE 890 220TH ST BRITT, IA 50423

SHIP-TO

DOUGLAS VERBRUGGE 890 220TH ST BRITT, IA 50423

Cust. Unit #: 505	Make:	FREIGHTLINER	Model:	CORONADO	CTag #:	NONE
VIN: 3ALXFB007LDLY2505	Model #:	CC132064T	In Serv Date:	08/27/2020	Year:	2020
Engine S/N: 06RE158803	Model #:	6067BK60	In Serv Date:	8-27-2020	Mileage:	272
Tran S/N:	Model #:		In Serv Date:		Eng Hrs:	0
Reefer S/N:	Model #:		In Serv Date:		Warr ID:	
APU S/N:	APU Gen S/N:		In Serv Date:		Date Create	e: 09/10/2020
			BOM/Spec:			

Sold Operations

Job#1 SHP-DETS 60 SHOP - DDC S40/50/60 LABOR

IPS- PICKUP & DELIVERY

S-CUST

S-CUST

Condition INSTALL HEATED DAVCO

DOUG: 641-860-0900

Cause

Correction

Job#3 PICKUP

DRAINED DAVCO ON UNIT. REMOVED OLD DAVCO AND MOUNTED NEW DAVCO ON TRUCK ON TRUCK. FOUND THE BEST WAY TO ROUT THE HOSE. SECURED HOSES OUT OF THE WAY OF THINGS AND HOOKED THEM TO THE NEW DAVCO. GOT NEW TEES AND PLUMBED THEM IN. FINISHED SECURING HOSES. TOOK OLD ELECTRICAL OFF FOR THE OIL FILTER HOUSING AND TOOK THE PLUG IN OUT OF THE TRUCK. INSTALLED NEW PLUG AND RAN THE ONE WIRE TO THE NEW DAVCO. RAN OTHER WIRE TO OIL FILTER HOUSING. PRESSURE TESTED UNIT WITHOUT COOLANT, IT PASSED. VACCUM FILLED TRUCK. PRESSURE TESTED WITH COOLANT, IT PASSED.

Qty	Item	Description	Price Each	Extended
	DETS60-GEN	SHOP - DDC S40/50/60 LABOR		570.00
1	DVC 382942FTL07	FUEL WATER SEPARATOR-380 EEF,	538.38	538.38
8	TYC DCT110HIR	TIE STRAP	0.78	6.24
1	PSM 8608059	HARNESS ASSY	101.95	101.95
1	DDE 23509542	SEALERTHREAD	25.47	25.47
6	012XXIMP 72331	HOSE CLAMP #10 LINED	1.63	9.78
2	Н8	5/8 X 3/8 BARB	13.09	26.18
1	IMP 92083	BARBED FITT 5/8X3/8	4.66	4.66
192	28447	5/8" X 300' Green Stripe, Heat	0.18	34.56
2	IMP 92084	BARBED FITT 5/8X1/2	6.17	12.34
2	6894511	3/4X3/4X1/2 FEMALE TEE	5.31	10.62
		Prepay: 0.00 Parts: 770.18 Labor: 570.00 M	isc: 0.00 Sublet: 0.00	1,340.18

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012073153:01 INVOICE DATE: 09/11/2020

INVOICE TERMS: NET30

VEHICLE#: 684935 ORIG. DOCUMENT: E012011737



Sold Operations (Cont.)

Condition

IPS- PICKUP & DELIVERY

Cause Correction

WENT TO MENARDS AND PICKED UP TEES

Oty Item Description Price Each Extended
!PICKUP PICKUP & DELIVERY 0.00

Prepay: 0.00 Parts: 0.00 Labor: 0.00 Misc: 0.00 Sublet: 0.00 0.00

Diagnostic/Tech Services: 39.90 Labor: 570.00 0.00 Misc. Charges: 770.18 Parts: Sublet: 0.00 Prepay: 0.00 Shop Supplies (ESC): 81.91 Taxes: 102.34 Total: 1,564.33

This document is subject to the General Terms and Conditions, the Mechanic's Lien Rider, the Abandoned Vehicle Rider, the Storage Fee & Lien Rider, Tampered Emissions Systems Policy, and Code of Conduct, which are expressly incorporated herein by reference, and are available at: https://www.istate.com/terms-conditions/ or in hard copy upon request.

All claims must be accompanied by this invoice. Diagnostic and Technical service charge may apply.

Customer Name	Acct Num Invoice Number Amt Due Date Due	Remittance Enclosed
DOUGLAS VERBRUGGE	195581 R012073153:01 1,564.33 10/11/2020	

Corporate Office - Accounts Receivable

(952) 854-2044 - Phone (952) 814-1127 - Fax ARTeam@istate.com FEDERAL ID: 41-1634357

www.istate.com

PLEASE REMIT PAYMENT TO :

Interstate Power Systems, Inc. NW 7244 PO Box 1450

MINNEAPOLIS, MN 55485-7244

Customer Signature:



407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 (515) 957-3300 PHONE:

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012078770:01 INVOICE DATE: 09/05/2021

INVOICE TERMS: N/20MF

VEHICLE#: ORIG. DOCUMENT: E012014507

684935



SERVICE INVOICE

BILL-TO

DLV TRUCKING LLC 890 220TH ST BRITT, IA 50423

SHIP-TO

DLV TRUCKING LLC 890 220TH ST BRITT, IA 50423

Cust. Unit #: 505	Make:	FREIGHTLINER	Model:	CORONADO	CTag #:	CF
VIN: 3ALXFB007LDLY2505	Model #:	CC132064T	In Serv Date:	08/27/2020	Year:	2020
Engine S/N: 06RE158803	Model #:	6067BK60	In Serv Date:	8-27-2020	Mileage:	80,765
Tran S/N:	Model #:		In Serv Date:		Eng Hrs:	0
Reefer S/N:	Model #:		In Serv Date:		Warr ID:	
APU S/N:	APU Gen S/N:		In Serv Date:		Date Create	e: 09/03/2021
			BOM/Spec:			

Sold Operations

Job#1 *IPS-PKG000036 S60 PREMIUM TUNE UP

S-CUST

Condition | S60 PREMIUM TUNE UP

DOUG: 641-860-0900

Cause

Correction |

WE PULLED THE UNIT IN THE SHOP. WE REMOVED THE LEFT SIDE GEAR CASE SUPPORT BRACKET & THE CENTER PORTION OF THE RAIN TRAY TO GAIN ACCESS TO THE UPPER ROCKER COVER & JAKES. WE REMOVED THE UPPER ROCKER COVER & JAKES. WE TUNED THE ENGINE AND REINSTALLED THE JAKE HOUSINGS. WE SET THE JAKE LASH, REINSTALLED THE UPPER ROCKER COVER, LEFT SIDE GEAR CASE SUPPORT & CENTER RAIN TRAY. WE STARTED & RAN THE ENGINE FOR PROPER OPERATION, LEAKS & CODES.=OK. THIS PORTION OF REPAIRS IS NOW COMPLETED. "DONE"

Qty	Item	Description Ex	tended
-1	*IPS-DET000036 S-LBDC	S60 PREMIUM TUNE UP TRUCK SHOW DISCOUNT	304.00
		Prepay: 0.00 Parts: 0.00 Labor: 429.00 Misc: -125.00 Sublet: 304.00 -125.00	
Job#2	SHP-OTH	SHOP - OTHER LABOR	S-CUST

Condition

WET AREA AROUND TRANS - CHECK & ADVISE

Cause Correction

WE CHECKED & FOUND THE REAR AREA OF THE TRNSMISSION WAS DAMP AROUND THE VSS. WE REMOVED, CLEANED & RESEALED THE VSS TO THE OUTPUT FLANGE OF THE TRANSMISSION. WE TOOK THE UNIT FOR A SHORT TEST DRIVE TO VALIDATE THE REPAIR. = OK. THIS PORTION OF REPAIRS IS NOW COMPLETED. "DONE"

Qty	Item	Description	Price Each	Extended
	OTH-GEN	SHOP - OTHER LABOR		144.00

INTERSTATE **Power Systems**

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 (515) 957-3300 PHONE:

FAX: www.istate.com

(515) 957-3301

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012078770:01 INVOICE DATE: 09/05/2021

INVOICE TERMS: N/20MF

VEHICLE#: ORIG. DOCUMENT: E012014507

684935



			Sold Operati	ons (Cont.)				
		Prepay: 0.00	Parts: 0.00	Labor: 144.00	Misc: 0.	00 Sublet: 0.00	144.00	
lob#3	SHP-DETS 60	SHOP - DDC S4	0/50/60 LABC)R			S	-CUSI
Condit	tion SET INJECTO	DRS TO 75						
Cause								
Correc	ction WE SET ALL	SIX INJ. CAL. C	ODES TO 75 A	T THE CUSTOME	RS REQUES	ST. "DONE"		
Qty	Item	Descrip	tion			Price Each	Exte	nded
· · · · · · · · · · · · · · · · · · ·	DETS60-GEN	SHOP -	DDC S40/50/6	0 LABOR			Ź	24.48
		Prepay: 0.00	Parts: 0.00	Labor: 24.48	Misc: 0.	00 Sublet: 0.00	24.48	
ob#4	CI	COURTESY TRUC	CK INSPECTION	7	,		S	-CUS
Condi	tion COURTESY TE	RUCK INSPECTION						
Cause								
	High and the base committee or							
	ction					D. / D h	7	
Qty	Item	Descrip	tion Y INSPECTION			Price Each	Exte	nded 0.00
	!Canda-CI	Prepay: 0.00 P			c: 0.00	Sublet: 0.00	0.00	0.00
		riepay. 0.00 r	arts. U.UU L	abor. 0.00 Mrs	c. 0.00	Sublec. 0.00		···
Tob#5	QI	QUALITY INSPE	CCTION				S	-CUSI
Condi	tion QUALITY INS	SPECTION						
Cause								
	Company Company (Company)							
	ction							
Qty	Item	Descrip			·	Price Each	Exte	nded
	!CandA-QI	~ .	INSPECTION					0.00
		Prepay: 0.00 P	arts: 0.00 L	abor: 0.00 Mis	c: 0.00	Sublet: 0.00	0.00	
Job#6	SHP-OTH	SHOP - OTHER	LABOR				S	-CUS
Condi	tion REPLACE FU	EL FILTER						
Cause								
	ction WE REMOVED	& REPLACED THE	DIRTY DAVCO					- II
o reconstruction of the contract of the contra		R OPERATION & LEA	KS.=OK. THIS	PORTION OF R	EPAIRS IS	2 NOW COMPLI	DUNI DUNI	5.
- Anna Caranta		R OPERATION & LEA		PORTION OF R		Price Each		nded
Corre	FOR PROPER	Descrip		S PORTION OF R			Exte	

Prepay: 0.00 Parts: 13.56 Labor: 50.40 Misc: 0.00 Sublet: 63.96

0.00



407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301

www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012078770:01
INVOICE DATE: 09/05/2021
INVOICE TERMS: N/20MF

VEHICLE#: 684935 ORIG. DOCUMENT: E012014507



Diagnostic/Tech Services:	15.32
Labor:	647.88
Misc. Charges:	-125.00
Parts:	13.56
Sublet:	0.00
Prepay:	0.00
Shop Supplies (ESC):	31.45
Taxes:	40.82
Total:	624.03

This document is subject to the General Terms and Conditions, the Mechanic's Lien Rider, the Abandoned Vehicle Rider, the Storage Fee & Lien Rider, Tampered Emissions Systems Policy, and Code of Conduct, which are expressly incorporated herein by reference, and are available at: https://www.istate.com/terms-conditions/ or in hard copy upon request.

All claims must be accompanied by this invoice. Diagnostic and Technical service charge may apply.

Customer Name	Acct Num	Invoice Number		Amt Due	Date Due Remittanc Enclosed	
DLV TRUCKING LLC	195581	R012078770:01	ackonsone.	624.03	10/20/2021	100

Corporate Office - Accounts Receivable

(952) 854-2044 - Phone (952) 814-1127 - Fax ARTeam@istate.com

FEDERAL ID: 41-1634357

www.istate.com

PLEASE REMIT PAYMENT TO :

Interstate Power Systems, Inc. NW 7244 PO Box 1450 MINNEAPOLIS, MN 55485-7244

Customer Signature: Date:

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301 www.istate.com

Cause

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012083201:01
INVOICE DATE: 08/10/2022

INVOICE TERMS: N/20MF

VEHICLE#: 684935 ORIG. DOCUMENT: E012016746



SERVICE INVOICE

BILL-TO

DLV TRUCKING LLC 890 220TH ST BRITT, IA 50423 SHIP-TO

DLV TRUCKING LLC 890 220TH ST BRITT, IA 50423

Cust. Unit #: 505 VIN: 3ALXFB007LDLY2505	Make: Model #:	FREIGHTLINER CC132064T	Model: In Serv Date:	CORONADO 08/27/2020	CTag #: Year:	819 2020
Engine S/N: 06RE158803	Model #:	6067BK60	In Serv Date:	8-27-2020	Mileage:	185,962
Tran S/N:	Model #:		In Serv Date:		Eng Hrs:	0
Reefer S/N:	Model #:		In Serv Date:		Warr ID:	
APU S/N:	APU Gen S/N:		In Serv Date:		Date Create	e: 08/05/2022
			BOM/Spec:			

		Sold Operations	
Job#1	*012-000011	IPS ALTOONA - DOT INSPECTION	S-CUST
Condit	ion IPS ALTOONA -	DOT INSPECTION	
	JASON 641-843	3-8177	
Cause			
Correc	etion PERFORMED IN	SPECTION, FILLED OUT FORM AND STICKER ONCE UNIT PASSED.	
Qty	Item	Description	Extended
	*012-OTH000011	IPS ALTOONA - DOT INSPECTION	85.00
		Prepay: 0.00 Parts: 0.00 Labor: 85.00 Misc: 0.00 Sublet: 85.00 0.00	
Job#2	*012-000010	IPS ALTOONA - CLUTCH ADJUSTMENT	S-CUSI
Condit Cause	clutch adjust	MENT	
Correc		TO PULL INSIDE . CLUTCH HAS ZERO FREE PLAY. GOT CLUTCH ADJ. AND ORKS AS IT SHOULD.	
Qty	Item	Description I	Extended
	*012-OTH000010	IPS ALTOONA - CLUTCH ADJUSTMENT	45.00
		Prepay: 0.00 Parts: 0.00 Labor: 45.00 Misc: 0.00 Sublet: 45.00 0.00	
Job#3	SHP-OTH	SHOP - OTHER LABOR	S-CUSI
Condit	cion C/STATES THEF	RE IS NO OIL PRESSURE / CHK AND ADVISE	

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER:

R012083201:01

INVOICE DATE: INVOICE TERMS: 08/10/2022 N/20MF

VEHICLE#:

684935 ORIG. DOCUMENT: E012016746



Sold Operations (Cont.)

Correction REMOVED DASH AND GAUGE CLUSTER. FOUND THAT THE OIL TEMP AND OIL PRESSURE GAUGES DROP OUT. MOVED WIRES FROM TEMP TO THE FRONT OF THE LINE IN THE CHAIN OF WIRES AND ALL PROBLEMS WENT AWAY. NEED TO CHANGE PIGTAIL AND SEE IF PROBLEM GOES AWAY. INSTALLED WIRE AND STARTED UNIT. UNIT IS STILL ACTING UP. INSTALLED NEW GAUGE AND OIL PRESS GAUGE STILL NOT WORKING AS IT SHOULD CHECKED WIRES FROM DDEC AND THEY ARE STILL READING GOOD. INSTALLED NEW GAUGE AND STARTED TRUCK, SEEN GAUGE BLANK OUT ONE TIME. TOOK FOR TEST DRIVE AND DID NOT SEE IT AGAIN. PARKED TRUCK AND LOOKED OVER FOR OIL LEAKS AND EXH LEAKS - OK.

Qty	Item	Description	Price Each	Extended
	OTH-GEN	TROUBLE SHOOTING		333.90
	OTH-GEN	DAISY CHAIN R&R		279.84
	OTH-GEN	GAUGE R&R X 2		198.75
1	A06-94006-007	HARNESS-DIM, JMPR, ICU4, GAUGE, 7"	19.57	19.57
1	A22-59205-101	GAUGE-ENGINE OIL PRESSURE, ICU4	106.29	106.29
1	A22-59210-101	ENG OIL TEMP BRT STD	105.27	105.27
		Prepay: 0.00 Parts: 231.13 Labor: 812.49 1	Misc: 0.00 Sublet: 0.00	1,043.62

COURTESY TRUCK INSPECTION

Job#4 CI

Condition | COURTESY TRUCK INSPECTION

Cause

Correction

Qty	Item		iption			Price Each	Extended
	!Canda-CI	COURT	ESY INSPECT	ION			0.00
		Prepay: 0.00	Parts: 0.00	Labor: 0.00	Misc: 0.00	Sublet: 0.00 0.	00

Job#5 QI QUALITY INSPECTION

S-CUST

S-CUST

Condition

QUALITY INSPECTION

Cause

Correction

Qty	Item	Desc	ription			Price Each	E:	xtended
	!CandA-QI	QUAL	QUALITY INSPECTION					0.00
		Prepay: 0.00	Parts: 0.00	Labor: 0.00	Misc: 0.00	Sublet: 0.00	0.00	
Job# 6	SHP-DETS60	SHOP - DDC	S40/50/60 L	ABOR				S-CUST

Condition

REPAIR EXHAUST LEAK AT MANIFOLD GASKETS & FLEX PIPE

Cause Correction of

REMOVED AIR INTAKE BOX. REMOVED TURBO DRAIN AND FEED LINES. REMOVED TURBO. REMOVED EXH MAN. CLEANED UP HEAD AND EXH MAN. INSTALLED EXH MAN WITH NEW GASKETS. INSTALLED TURBO . REMOVED OLD FLEX PIPE. REMOVED OLD CLAMPS AND INSTALLED NEW PIPE AND CLAMPS. INSTALLED AIR INTAKE PIPE. INSTALLED AIR BOX.

Qty	y Item	Description	Price Each Extend	ded



407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 (515) 957-3300 PHONE:

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012083201:01

INVOICE DATE: INVOICE TERMS:

08/10/2022 N/20MF

VEHICLE#: ORIG. DOCUMENT:

684935 E012016746



		Sold Operations (Cont.)		
	DETS 60-GEN	EXHAUST LEAK REPAIR		650.31
	DETS 60-GEN	STEAM CLEAN & ROAD TEST		171.72
1	DDE 08929529	GASKET	5.58	5.58
1	DDE 08929285	GASKET	1.38	1.38
4	DDE 11506101	NUT	1.48	5.92
4	DDE 08929169	WASHER	2.92	11.68
3,	DDE 23539193	GASKET	15.98	47.94
4	DDE 23507438	STUD EXH	8.31	33.24
1	IMP 9184	ANTI-SEIZE 16 oz	24.91	24.91
1.	DN J024837	FLX CNNCTR	41.47	41.47
2	DN X007785	SEALCLAMP	22.36	44.72
4	IMP 73422	3M SFC CND DISC 2" CRS	3.37	13.48
2	IMP 73329	MEDALION WHL 3X 1/16X 3/8	12.92	25.84
		Prepay: 0.00 Parts: 256.16 Labor: 822.03 N	fisc: 0.00 Sublet: 1	,078.19
Job#7	PICKUP	IPS- PICKUP & DELIVERY		S-CUSI
Condit Cause Correc		& DELIVERY		
Qty	Item	Description	Price Each	Extended
	!PICKUP	PICKUP & DELIVERY		0.00
		Prepay: 0.00 Parts: 0.00 Labor: 0.00 Misc:	0.00 Sublet: 0.00 0	. 00

Total:	2,783.19
Taxes:	182.08
Shop Supplies (ESC):	234.88
Prepay:	0.00
Sublet:	0.00
Parts:	487.29
Misc. Charges:	0.00
Labor:	1,764.52
Diagnostic/Tech Services:	114.42

This document is subject to the General Terms and Conditions, the Mechanic's Lien Rider, the Abandoned Vehicle Rider, the Storage Fee & Lien Rider, Tampered Emissions Systems Policy, and Code of Conduct, which are expressly incorporated herein by reference, and are available at: https://www.istate.com/terms-conditions/ or in hard copy upon request. All claims must be accompanied by this invoice. Diagnostic and Technical service charge may apply.

INTERSTATE
Power Systems

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301

www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012083201:01 INVOICE DATE: 08/10/2022 INVOICE TERMS: N/20MF

VEHICLE#: 684935 ORIG. DOCUMENT: E012016746



Customer Name	Acct Num Invoice Number	Amt Due Date Due Remittance Enclosed
DLV TRUCKING LLC	195581 R012083201:01	2,783.19 09/20/2022

Corporate Office - Accounts Receivable

(952) 854-2044 - Phone (952) 814-1127 - Fax ARTeam@istate.com FEDERAL ID: 41-1634357

www.istate.com

PLEASE REMIT PAYMENT TO :

Interstate Power Systems, Inc. NW 7244 PO Box 1450 MINNEAPOLIS, MN 55485-7244

Customer Signature: Date:

INTERSTATE **Power Systems**

407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012083381:02 INVOICE DATE:

08/24/2022

INVOICE TERMS: N/20MF

VEHICLE#:

684935 ORIG. DOCUMENT: E012016834



SERVICE INVOICE

BILL-TO

DLV TRUCKING LLC 890 220TH ST BRITT, IA 50423 SHIP-TO

DLV TRUCKING LLC 890 220TH ST BRITT, IA 50423

Cust. Unit #: 505	Make:	FREIGHTLINER	Model:	CORONADO	CTag #:	847
VIN: 3ALXFB007LDLY2505	Model #:	CC132064T	In Serv Date:	08/27/2020	Year:	2020
Engine S/N: 06RE158803	Model #:	6067BK60	In Serv Date:	8-27-2020	Mileage:	190,044
Tran S/N:	Model #:		In Serv Date:		Eng Hrs:	0
Reefer S/N:	Model #:		In Serv Date:		Warr ID:	
APU S/N:	APU Gen S/N:		In Serv Date:		Date Create	e: 08/22/2022
			BOM/Spec:			

Sold Operations

Job#1 *PKG-ETN000001 CLUTCH - NEW REPLACEMENT

S-CUST

Condition

REPLACE CLUTCH - BITS OF SPRING FOUND IN HOUSING

Cause

Correction

HAD TO REMOVE EXHAUST PIPES AND DROP AN AIR TANK TO GET TRANNY OUT. REMOVED CLUTCH AND FLYWHEEL. FLYWHEEL WAS BAD AND NEEDS A NEW ONE. INSTALLED PILOT BEARING IN NEW FLYWHEEL, INSTALLED FLYWHEEL WITH NEW BOLTS AND TORQUED TO SPEC. INSTALLED CLUTCH AND TORQUED TO SPEC. INSTALLED TRANNY, INSTALLED THE TRANS BOLTS WITH BLUE LOCKTITE AND TORQUED TO 55FT/LBS. REMOVED THE JACK. INSTALLED THE REAR TRANS SUPPORT BAR. ADJUSTED THE CLUTCH TO 1/2IN AT THROWOUT AND BRAKE. THEN MADE SURE IT HAD AN 1/8IN AT FORK AND THROWOUT. LINKAGE WAS PERFECT AT 1 & 3/4" OF FREE TRAVEL. PUT CARRIER MOUNT BACK UP FOR FRONT SHAFT AND THEN HOOKED THE BACK SHAFT UP USING NEW STRAPS. GREASED THE THROWOUT BEARING AND THE THROUGH SHAFTS. GREASED THE DRIVELINE THAT WAS REMOVED. CHECKED PLAY IN CARRIER BEARING, NONE FOUND. CHECKED FLUID LEVELS. GOOD. RAN UNIT. CLUTCH OPERATES FINE. GOES INTO GEAR GREAT. RELEASES AT A GOOD POINT. LET UNIT AIR UP. INSTALLED THE SHIFTER BOOT, WITH BOLTS IN HOLES THAT ARE GOOD (SOME HUCKS NEED REPLACED AT SOME POINT). SHUT UNIT OFF, CHECKED FOR AIR LEAKS AND FLUID LEAKS, NONE FOUND. PUT INSPECTION PLATE ON. STEAM AND ROAD TEST.

Qty	Item	Description Extended	d
1 12 1	*IPS-CLU000016 SP 308925 82 DDE 08929795 DDE 05100532	CLUTCH - NEW REPLACEMENT 2,999.0 CLUTCH-EASYPEDAL ADVANTAGE 15. BOLT PLATE	0
		Prepay: 0.00 Parts: 1,559.52 Labor: 1,439.48 Misc: 0.00 2,999.00 Sublet: 0.00	
Job#2	CI	COURTESY TRUCK INSPECTION S-CUS	T

Condition

COURTESY TRUCK INSPECTION

Cause



407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 (515) 957-3300 PHONE:

FAX: (515) 957-3301 www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012083381:02

INVOICE DATE: INVOICE TERMS:

08/24/2022 N/20MF

0.00

VEHICLE#:

684935

ORIG. DOCUMENT: E012016834



			Sold Ope	erations (Cont.)			
Correc	ction		•	, ,			
Qty	Item	Descr	ciption			Price Each	Extended
	!Canda-CI	COURT	ESY INSPECT	ION			0.00
		Prepay: 0.00	Parts: 0.00	Labor: 0.00	Misc: 0.00	Sublet: 0.00 0	.00
Job#3	0.7	QUALITY INS	SPECTION				S-CUSI
$UUD_{\pi}J$	Q1	QUADITI IN	or horizon,				
		-	31 201 1 0 IV.				
Condit		-	31201101				
		-	31 <u>1</u> 0110 ₁ 1				
Condit Cause	QUALITY I	-	5120116N				
Condit Cause	QUALITY I	NSPECTION	ription			Price Each	Extended
Condit Cause Correc	tion QUALITY I	NSPECTION Descr		ON		Price Each	Extended 0.00
Condit Cause Correc	QUALITY I	NSPECTION Descr	ription	ON Labor: 0.00	Misc: 0.00	Price Each Sublet: 0.00 0	0.00
Condit Cause Correc	QUALITY I	Descr QUALI Prepay: 0.00	iption TY INSPECTION	Labor: 0.00	Misc: 0.00		0.00
Condit Cause Correc	QUALITY I ction Item !CandA-QI SHP-DETS60	Descr QUALI Prepay: 0.00	Tiption TY INSPECTION Parts: 0.00	Labor: 0.00	Misc: 0.00		0.00

Correction REMOVED THE OLD INPUT KIT. INSTALLED THE NEW INPUT KIT. TRANS IS READY TO BE INSTALLED. REMOVED REAR MAIN SEAL. CLEANED UP SURFACES AND INSTALLED NEW SEAL. INSTALLED NEW FLYWHEEL TORQUED TO SPEC. RAN TRUCK TO LET BUILD UP HEAT AND CHECKED REAR MAIN SEAL, NO LEAK, SEAL IS GOOD.

Qty	Item	Description	Price Each	Extended
	DETS 60-GEN	SHOP - DDC S40/50/60 LABOR		556.50
1	DDE 23519651	SEAL	76.50	76.50
2	SP 6.5 70 18X	STRAP BOLT KIT	17.06	34.12
1	FUL K2468	CLUTCH INST KIT	257.81	257.81
3	DN X007785	SEALCLAMP	22.36	67.08
1	IAT 23514177	FLYWHEEL, DETROIT DIESEL SERIE	312.58	312.58
3	PIC 4620	NON-CHLOR BRAKE CLNR	4.13	12.39
2	IMP 91199	A/B UNION 5/32 PUSH IN	12.50	25.00
		Prepay: 0.00 Parts: 785.48 Labor: 556.50 Mis	sc: 0.00 Sublet:	1,341.98



407 ADVENTURELAND DRIVE NE ALTOONA, IA 50009-4224 PHONE: (515) 957-3300

FAX: (515) 957-3301

www.istate.com

ACCOUNT NUMBER: 195581

INVOICE NUMBER: R012083381:02 INVOICE DATE: 08/24/2022 INVOICE TERMS: N/20MF

VEHICLE#: 684935 ORIG. DOCUMENT: E012016834



Total:	4,772.10
Taxes:	312.19
Shop Supplies (ESC):	79.97
Prepay:	0.00
Sublet:	0.00
Parts:	2,345.00
Misc. Charges:	0.00
Labor:	1,995.98
Diagnostic/Tech Services:	38.96

This document is subject to the General Terms and Conditions, the Mechanic's Lien Rider, the Abandoned Vehicle Rider, the Storage Fee & Lien Rider, Tampered Emissions Systems Policy, and Code of Conduct, which are expressly incorporated herein by reference, and are available at: https://www.istate.com/terms-conditions/or in hard copy upon request.

All claims must be accompanied by this invoice. Diagnostic and Technical service charge may apply.

Customer Name	Acct Num Invoice Number Amt Due Date Due	Remittance Enclosed
DLV TRUCKING LLC	195581 R012083381:02 4,772.10 09/20/2022	To the same of the

Corporate Office - Accounts Receivable (952) 854-2044 - Phone (952) 814-1127 - Fax ARTeam@istate.com FEDERAL ID: 41-1634357

www.istate.com

PLEASE REMIT PAYMENT TO :


Interstate Power Systems, Inc. NW 7244 PO Box 1450 MINNEAPOLIS, MN 55485-7244


Customer	Signature:	Date:	

Submitting Location	LTGD INTERSTATE POWER SYSTEMS, INC.	
Product S/N	06RE158803	Unit#
Make	DDE	Base Model
In Service Distance	89 MILES	Model
In Service Date	08/27/2020	Order Date
Cab Start Date		Offline Date
Build Date	07/29/2020	Customer Name
Refurbished	No	Special Conditions
PDI Date		PDI Submitting Location

-	
Campaign	
3	í
20	
. <u>.</u> .	
3	
	j.
	ı
	i
റ	
2	
ਰੰ	
<u>a.</u>	ı
9	
_	
Campaign Description	
Sc	
- ⊋:	
¥	ì
9	
	ŀ
	į.
	ł
	•
_	
ก	
\$	
Active	
_	
hactiv	
<u> </u>	ì
7	
at	
/ate Date	
Da	
ī	
	ŀ
刀	
ä	
욢	
Reactivate Date	H
ite.	0
, ,	E
<u>a</u>	E
e e	
	E
	Ď
	E
	E
П	
End Date	
Ū	
ā	
Ö	
_	
돌깐	١.,

BASIC VEHICLE	Coverages		
P	Time		
MONTHS	Period		
8/27/2021	End Date		CHASSIS
700000	Distance	Chassis - Warranty Coverage	CHASSIS COVERAGES - 3ALXFB007LDLY2505
MILES	Unit#	Coverage	XFB007LDLY2505

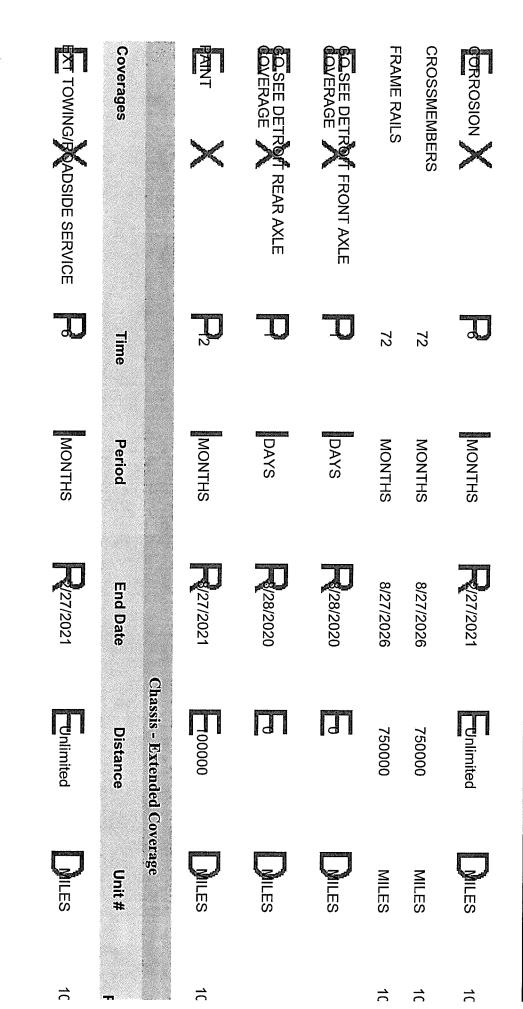

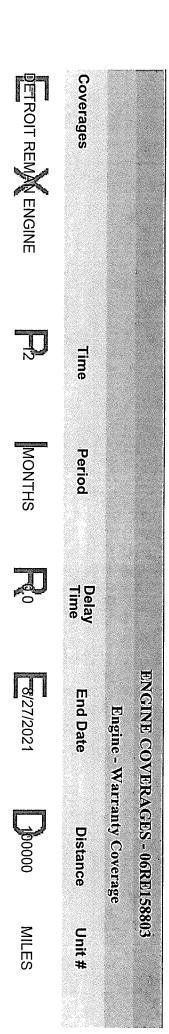

				Engi	Engine - STEPUP Coverages	Coverages				100
Coverages	Time	Period	End Date	Distance	ance	Unit #		M	OT .	Ħ
EXT DDC STEPUP PROGRAM 4	36	MONTHS	8/27/2023	300002	02	MILES		Z	Z	Z
Exceptions	Parts	Labor	Unit #	Distance	Unit #		M	10	Ħ.	
EXT DDC AIR COMPR	0	0	MONTHS	0	MILES		Z	Z	z	. 8
EXT DDC AIR COMPR/TF550	0	0	MONTHS	0	MILES		Z	Z	z	
EXT DDC ALT/GEN	0	0	MONTHS	0	MILES		Z	Z	z	
EXT DDC ENGINE BRAKE	0	0	MONTHS	0	MILES		Z	Z	Z	
EXT DDC FUEL INJECTION SYSTEM	0	0	MONTHS	0	MILES		Z	Z	z	
EXT DDC HARNESS AND CONN	0	0	MONTHS	0	MILES		Z	Z	z	8
EXT DDC HYD PUMP	0	0	MONTHS	0	MILES		Z	Z	z	
EXT DDC INJECTOR	T	24	RIONTHS	T50002	NILES		Z	Z	Z	
EXT DDC PILOT BEARING	0	0	MONTHS	0	MILES		Z	Z	Z	
EXT DDC SEALS AND GASKETS	36	36	MONTHS	300002	MILES		Z	Z	Z	
EXT DDC SENSORS	0	0	MONTHS	0	MILES		Z	Z	Z	
EXT DDC STARTER	0	0	MONTHS	0	MILES		Z	Z	Z	
EXT DDC VACUUM PUMP	0	0	MONTHS	0	MILES		Z	Z	Z	

BASIC AXLE - REAR/DRIVE	Coverages		
60	Time		
MONTHS	Period		
8/27/2025	End Date	Warranty Coverage	
500000	Distance	- REAR AXLE RI	AXLE COVERAGES
MILES	Unit #	ity Coverage - REAR AXLE REAR - 771DDR-M007317T	GES
10	7	07317T	

Coverages	SEALS AND GASKETS
Time	36
Period	MONTHS
Begin Date	8/27/2023
Detroit Connect Coverage End Date Di	300000
overage Distance	MILES
	10

BASIC VEHICLE

COVERAGE INCLUDES ALL FACTORY-INSTALLED COMPONENTS OF THE CHASSIS/VEHICLE THAT ARE NOT EXCLUDED ELSEWHERE II OR DESCRIBED AS HAVING A DIFFERENT TIME, OR DISTANCE, OR HOURS, OR LISTED SEPARATELY ON EACH NEW VEHICLE COVERA COMPLETE LIST OF EXCEPTIONS AND EXCLUSIONS. ALSO EXCLUDED ARE COMPONENTS WARRANTED DIRECTLY BY COMPONENT I

CAB STRUCTURE

COVERAGE INCLUDES CAB AND INTEGRAL SLEEPER STRUCTURAL COMPONENTS, STRUCTURAL COMPONENTS OF FACTORY INSTAI AND HOODS. EXCLUDES ALL BOLT-ON COMPONENTS INCLUDING DOOR AND HOOD HINGES, LATCHES, GUIDES, AND OTHER MOUNTI

CROSSMEMBERS

COVERAGE INCLUDES CROSSMEMBERS, GUSSETS, AND HUCK-MOUNTING BOLTS THAT ATTACH GUSSETS TO CROSSMEMBERS AND ANY BOLT-ON ITEM ATTACHED WITH EITHER CONVENTIONAL OR HUCK BOLTS.

FRAME RAILS

COVERAGE IS LIMITED TO BREAKING OR CRACKING OF FACTORY-INSTALLED FRAME RAILS, EXCLUDES ALL BOLT-ON ITEMS ATTACHED WITH EITHER CONVENTIONAL OR HUCK BOLTS. FRAME RAIL LINERS, FRAME RAIL EXTE

CORROSION

INCLUDES: WARRANTY AGAINST CORROSION TO ANY METAL OR METAL ALLOY COVERAGE INCLUDES WARRANTY AGAINST CORROS

- **EXCLUDES:**

- CORROSION CAUSED BY GENERAL RUST (E.G., RUST ON THE UNFINISHED BACKSIDE OF A BUMPER)
 SURFACE RUST CAUSED BY CHIPS OR SCRATCHES IN THE PAINT OR CHROME SURFACES
 CORROSION CAUSED BY SEVERE WASH SOLUTIONS, CLEANING SOLVENTS, DETERGENTS, COMPOUNDS
 CORROSION CAUSED BY SALINITY IN THE ENVIRONMENT OR CORROSIVE SALTS AND/OR CHEMICALS USED ON THE ROAD SURFAC
 CORROSION DUE TO IMPROPER USE, MISUSE, OR ABUSE, NEGLIGENCE, INCLUDING IMPROPER OR INSUFFICIENT MAINTENANCE
 CORROSION DUE TO OCEAN SPRAY
 CORROSION DUE TO ENVIRONMENTAL DAMAGE, INCLUDING AIRBORNE FALLOUT (INCLUDES CHEMICALS, TREE SAP, ETC.), OR OTH
- NATURE

- CORROSION DUE TO DAMAGE CAUSED BY HIGH-PRESSURE WASHING
 CORROSION CAUSED BY ACID RAIN OR OTHER INDUSTRIAL FALLOUT
 CORROSION DUE TO IMPROPER PREVENTION MEASURES DURING STORAGE OR USE
 CORROSION OR RUST ON TONE RINGS, ROTORS, OR DRUMS

CHASSIS PAINT

COVERAGE INCLUDES ALL FACTORY-PAINTED SURFACES ON FRAME RAILS, CROSSMEMBERS/GUSSETS, FRONT AND REAR BUMPEF COMPONENTS, DRIVELINES, FUEL TANKS, AIR TANKS, WHEEL END EQUIPMENT, TOOL BOXES, BATTERY BOXES, ACCESS STEPS, AT SUCH AS PEELING OR NON-ADHESION. EXCLUDES U-JOINTS AND ANY DAMAGES TO PAINT OR PAINTED SURFACE SUCH AS CHIPS A

BRIGHTWORK

COVERAGE INCLUDES ALL FACTORY INSTALLED COMPONENTS WITH CHROME, POLISHED ALUMINUM, OR POLISHED STAINLESS STE OF BUMPERS, AND CONCEALED OR INNER SURFACES.

INCLUDES: INJECTOR ASSEMBLY ONLY

SEALS AND GASKETS

INCLUDES: INPUT/OUTPUT SEALS AND HOUSING SEALANT

DETROIT REMAN ENGINE

COVERAGE INCLUDES ALL COMPONENTS SUPPLIED WITH THE REMANUFACTURED DETROIT ENGINE AT THE TIME OF SALE AND USE COVERAGE ALSO INCLUDES TOWING AND ROADSIDE ASSISTANCE IN A TRUCK DOWN SITUATION WITH A WARRANTABLE DETROIT F, VEHICLE; DRIVELINE REIMBURSEMENT MAY BE AVAILABLE IF TOWING COMPANY REMOVED BUT DID NOT REINSTALL.

GO SEE DETROIT FRONT AXLE COVERAGE

GO SEE DETROIT FRONT AXLE PRODUCT AND VIEW ASSOCIATED COVERAGE

GO SEE DETROIT REAR AXLE COVERAGE

GO SEE DETROIT REAR AXLE PRODUCT AND VIEW ASSOCIATED COVERAGE

BASIC AXLE - REAR/DRIVE

A rear drive axle can be a single or tandem axle configuration. Coverage includes all axle components supplied/manufactured by Detroit. Warrantab carrier assembly, differential assembly, power divider, and axle shafts. Seals and gaskets may have a different coverage period; see specific coverate, suspension and torque rod brackets, wheel end equipment, wiring, yokes, and attaching hardware.

EXT TOWING/ROADSIDE SERVICE

INCLUDES: MAX PAYMENT AS DISPLAYED, PER OCCURRENCE, FOR TOWING &/OR ROADSIDE ASSISTANCE FOR A DEFECT IN MATERI THE SAFE & LAWFUL OPERATION OF THE VEHICLE. MAX PAYMENT AS DISPLAYED NO MATTER THE CURRENCY. IF TOWING IS ASSOC CHARGES MUST BE ON THE SAME CLAIM. IF THE TOW COMPANY REMOVED BUT DID NOT REINSTALL THE DRIVELINE OR AXLE SHAF OR AXLES SHAFTS WILL BE REIMBURSED. EXCLUDES: DAMAGE TO THE VEHICLE FROM IMPROPER TOWING.

TOWING ONLY – IF TOWING IS NOT ASSOCIATED W/DTNA WARRANTABLE FAILURE, TOWING CHARGES MUST BE FILED AS A STAND A ENTER FAILED COMPONENT CODE F99-999-093. ***DOES NOT ALLOW ROAD CALL OR TRAVEL TIME/DISTANCE***

ROADSIDE SERVICE ONLY – IF ROADSIDE SERVICE IS NOT ASSOCIATED W/DTNA WARRANTABLE FAILURE, ROADSIDE SERVICE CHAF INCLUDES ANY TRAVEL TIME/DISTANCE AND/OR EXPENSE TYPE OF TOWING. PLEASE LEAVE THE PFP FIELD BLANK AND ENTER FAIL IF ONLY CLAIMING FOR TOWING***

ADDITIONAL COVERAGE INFO AVAILABLE ON THE ASP WEBSITE WWW.AFTERMARKETSERVICEPRODUCTS.COM

EXT DDC AIR COMPR

COVERS THE AIR COMPRESSOR ASSEMBLY, INCLUDING THE UNLOADER VALVE

EXT DDC AIR COMPR/TF550

INCLUDES: COMPRESSOR AIR BRAKES; CYLINDER HEAD GASKET

INCLUDES: ELECTRICAL CONNECTORS; ELECTRONIC, ENGINE, EXTERNAL INJECTOR WIRING HARNESSES; OXYGEN SENSOR; ENGIN

EXT DDC HYD PUMP

INCLUDES: STEERING OIL PUMP BODY; MOUNTING BRACKET AND GASKETS; POWER STEERING PUMP COUPLING AND COVER

EXT DDC INJECTOR

INCLUDES: ELECTRONIC INJECTOR ASSEMBLY; ELECTRONIC INJECTOR O-RING

EXT DDC PILOT BEARING

INCLUDES: PILOT BEARING

EXT DDC SEALS AND GASKETS

INCLUDES: SEALS & GASKETS

EXT DDC SENSORS
INCLUDES: ENGINE SENSORS; ENGINE WIRING HARNESS

EXT DDC STARTER

INCLUDES: STARTER MOTOR ASSEMBLY

EXT DDC VACUUM PUMP

INCLUDES: VACUUM PUMP ASSEMBLY

EXT DDC STEPUP PROGRAM 4

INCLUDES: COVERS SPECIFIC ENGINE COMPONENTS. ORIGINAL OR REPLACEMENT PARTS THAT FAIL AS THE RESULT OF WEAR-OU

COMMERCIAL MOTOR VEHICLE MAINTENANCE RECORD

VEHICLE IDENTIFY	NG INFORMATION
CORONADO Vehicle make	Company vehicle number, if any
Vehicle year	Tire size
3 A J.X FB 007 LOLY 2505 Vehicle identification number	Owner, if leased

Date of Maintenance	Operation Performed	Vehicle Mileage	Date Next Maintenance Due
2/20	Full Service	122,076	
3/18	FullSertice	134240	
4/15	Full Service	143622	
15/13	FUN Service	157,951	()
6/17	FUIL Service	171,135	
7/22	FVII Service	182,433	
9/4	Evil Serve	195345	,
10/9/22	Full service + air filter	208,651	
U/17/22	full Service	219,951	
12/16/27	FUN Sarvice	037 094	/

COMMERCIAL MOTOR VEHICLE MAINTENANCE RECORD

VEHICLE IDENTIFYI	NG INFORMATION
LORONADO Vehicle make	Company vehicle number, if any
Vehicle year	Tire size
3 PLX FB 00 JLBLY 2505 Vehicle identification number	Owner, if leased

Date of Maintenance	Operation Performed	Vehicle Mileage	Date Next Maintenance Due
11/7	Change oil + fuel	11,492	
12/3/	Chargoil & Fael	24,234	
2/12-21	Chance ail - Fuel	35984	
5/8	Charage Oit A Fas	47,600	
6/12	Chan, Oil/Fuel	60,180	
7/23	Chargoil/Fuel	72,495	
9/22	Oil, Fuel, Coolaut	83,699	
12/10/21	Full Service / Stir new	97,259	<i>#</i> -5
1/21/22	Follswice	109,085	
7/17/22	Tires all 10	121,113	